



DDR /7503/05 PROBLEM SOLVING UNDERWATER LIGHT

VERIFICATION POSSIBLE MISSED OBSERVANCE OF THE INSTRUCTIONS

PROBLEM	CAUSE	SOLUTION	
IT DOESN'T WORK	DISCHARGE	CHARGE 24h	
	THE CHARGER DOESN'T WORK	INTERNAL FUSE	HOME LINE
		REPAIR BROKEN CABLES	OXIDIZED CONTACTS
		CLEAN THE CONTACTS	
	OXIDIZED BULB	CLEAN THE CONTACTS	
	VIOLENT IMPACT	LUMINOUS SOURCE BROKEN - SEND BACK THE LAMP TO FA&MI SRL REPLACE THE BATTERIES IN THE CORRECT WAY - REPLACE THE BULB	
	BATTERIES OUT LODGING	PLACE THE BULB IN THE LODGING	CLEAN THE CONTACTS
		CHECK THE POLARITY + - AND THE POSITION	
	THE LIGHTING RING IS OXIDIZED	ASK TO THE RESELLER	
	BROKEN CABLE	ASK TO THE RESELLER FOR A SUBSTITUTION SEE THE INSTRUCTION OF YOUR LAMP	
LIGHTING SYSTEM NOT LINE UP	LINE UP WITH THE INTERNAL COLOURED SIGN OF REFERENCE		
ELECTRICAL SYSTEM DAMAGED	SUBSTITUTE ROTATING THE COMPLETED ELECTRICAL SYSTEM	FOR FIND THE PHASE HEAR THE RELAY CONNECTION (OR SEND BACK TO FA&MI)	
	BULB NOT COMPATIBLE WITH THE HEAD- TESTA NON COM TORCH "LEDIUM" MODEL - OXIDIZATION: THE CAP DO NOT MAKES CONTACT WITH THE EXTERNAL BODY	SUBSTITUTE THE BULB OR THE HEAD WITH THE ORIGINAL ONE REMOVE THE O-RING - CLEAN THE SCREW OF THE CAP AND OF THE BODY - REPLACE THE O-RING WITH THE GREASE	
PRESENCE OF WATER INSIDE THE TORCH	O-RING'S CAP OR CONNECTOR RUINED	SUBSTITUTE IT / SEE CODE ON THE INSTRUCTION OF THE LAMP	
	DIRTY O-RING	CLEAN AND GREASE	
	VIOLENT IMPACT	SUBSTITUTE THE DAMAGED PART	
	MODEL WITH CONNECTION CABLE: EXCESSIVE / ACCIDENTAL STRETCHING OF THE CABLE	MODELS WITH THE POSSIBILITY TO SUBSTITUTE AUTONOMOUSLY THE CABLE FROM BOTH SIDES - ORDER THE COMPLETED CABLE (see code on page 14 of the catalogue 8 th edition)	
REDUCTION OF THE AUTONO	BATTERY DISCHARGED	RECHARGE 2/4 TIMES FOR 24HRS WITHOUT MAKE IT COMPLETED DESCHARGED - ALWAYS RECHARGE IT BEFORE AND AFTER USE	
	EXHAUSTED BATTERIES	REPLACE THEM (see instructions of your lamp)	
	COLD	PRESERVE TO A TEMPERATURE AMONG +10 min +45 max	
	CHARGER WORK AND MODEL	VERIFY THAT THE RED LED STAY TURNED ON FOR 2/4 HRS	
	THE RED LED OF THE CHARGER TURN OFF AFTER 10/20min	SUBSTITUTE THE EXHAUSTED BATTERY	
IF YOU KNOW WHICH IS THE PROBLEM BUT YOU DON'T HAVE SPARE PARTS	ASK FOR SPARE PARTS DIRECTLY TO US, IF POSSIBLE WITH A PHOTO AND SHORT DESCRIPTION OF THE PROBLEM	FOR THE REQUEST UNDER GUARANTEE, PLEASE SEND ALSO A COPY OF THIS ONE	
REDUCED EFFICIENCY	EXHAUSTED OR DAMAGED BATTERY - LED LIGHT WHITE COLOR AS SUNLIGHT	SUBSTITUTE THE BATTERY - BUY A PRODUCT OF LOW TEMPERATURE COLOR (3000°4000°K) FOR DIURNAL USE	
LED OR HID BULB BROKEN	WELDING - VIOLENT IMPACT	SEND BACK TO FA&MI WITH A SHORT DESCRIPTION OF THE PROBLEM	